DR.WG.Nº E.E.A.22.
PART Nº EA.10063.

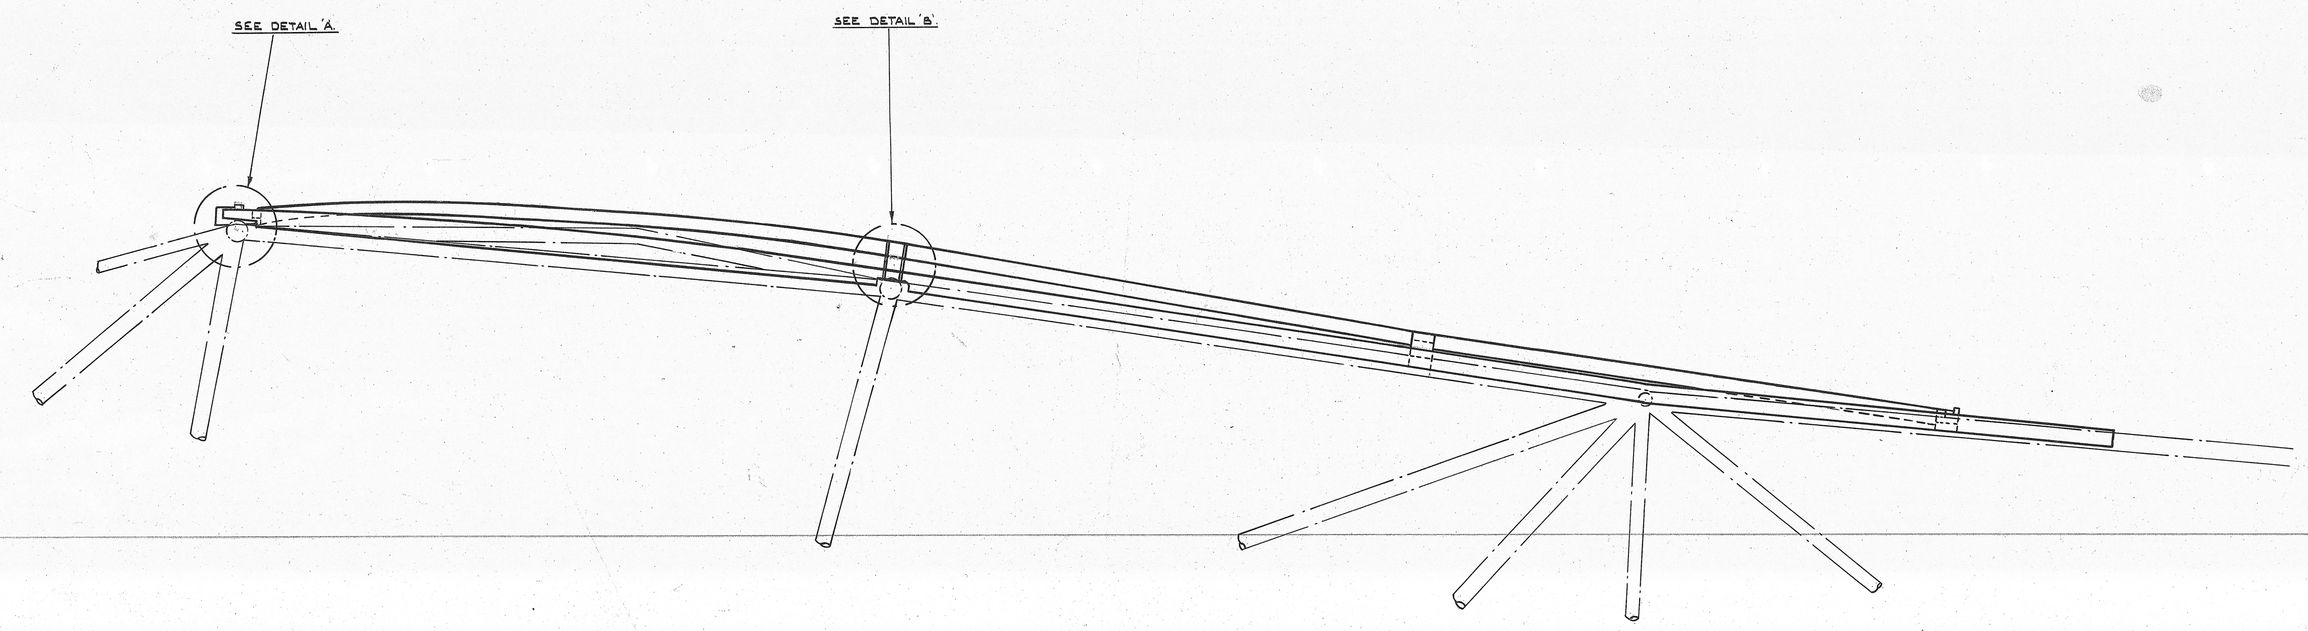

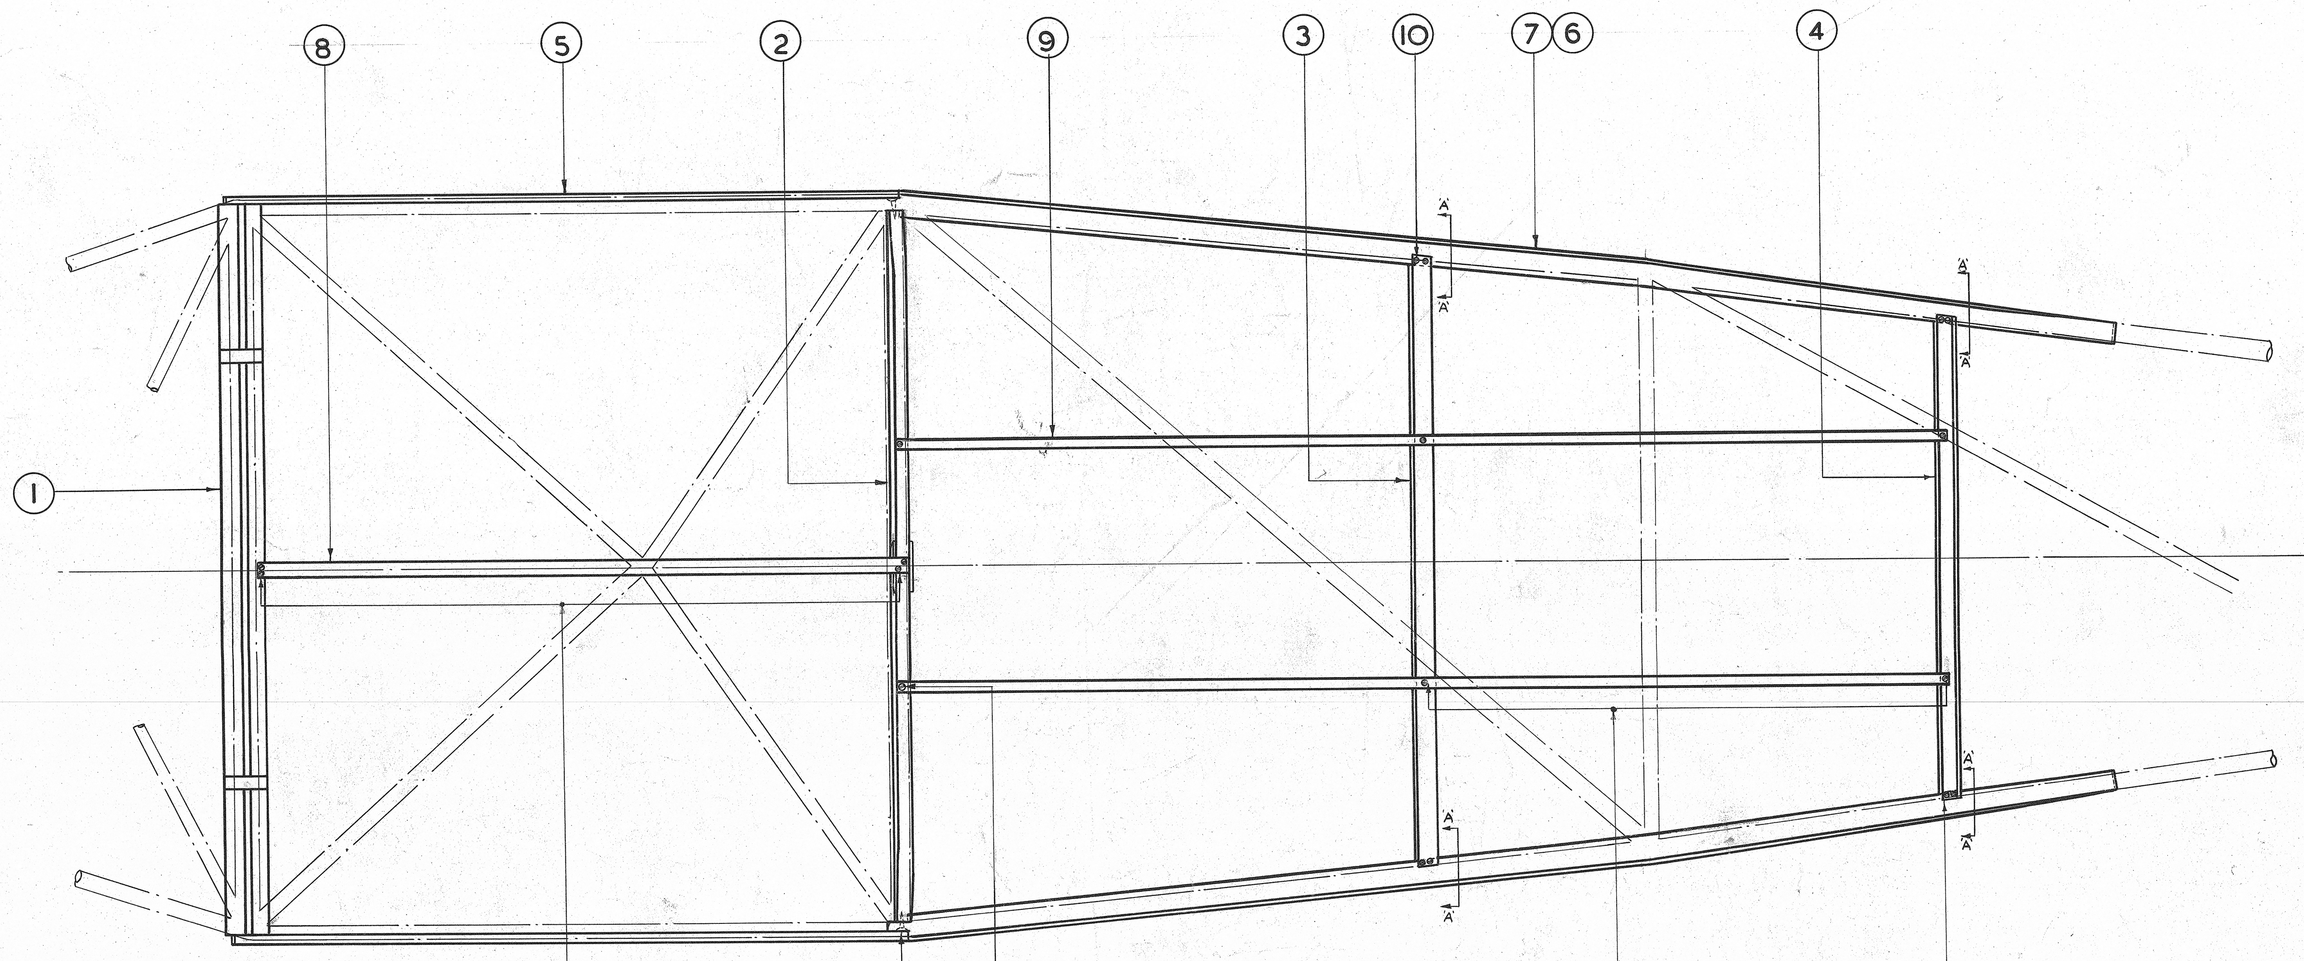

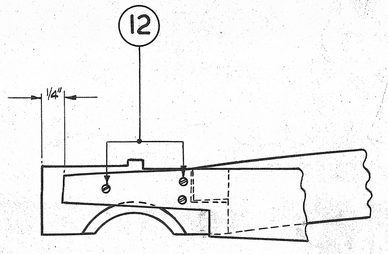

ENLARGED VIEW OF DETAIL 'A'.

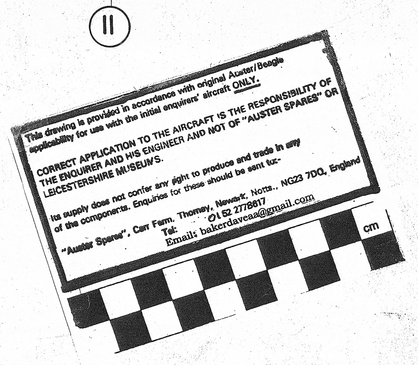

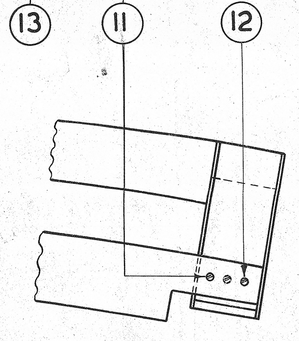

ENLARGED VIEW OF DETAIL 'B'.

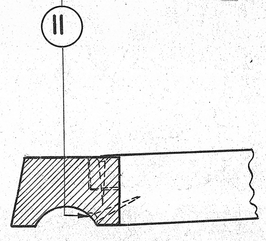

SECTION 'A'-'A'
PORT SIDE SHOWN.

ISSUE	MOD. Nº	INTERNAL MOD Nº	CLASS	APP.	R.T.O.
2.	AM91	664	4		
1.	MOD.70		3.	J.H.P.	

TYPE:~ AUSTER

ITEM Nº	DESCRIPTION.	PART Nº OR DRWG Nº	Nº OFF.
1.	FRONT CROSS MEMBER.	E.10074	1.
2.	CROSS MEMBER.	EA10075	1.
3.	CROSS MEMBER.	E.10076	1.
4.	REAR CROSS MEMBER.	E.10077	1.
5.	OUTER FAIRING FORMER.	D.7166	2.
6.	PORT REAR OUTER FAIRING FORMER.	E10078	1.
7.	STBD REAR OUTER FAIRING FORMER.	E10079	1.
8.	CENTRE FORMER.	E10080	1.
9.	FORMER.	E10081	2.
	WOODSCREW Nº2.	AGS 250/4	8.
11.	WOODSCREW. Nº2	AGS 250/5	16.
12.	WOODSCREW. Nº2.	AGS 250/7	8.
13.	WOODSCREW Nº4	AGS 250/25	2.

PROTECTIVE TREATMENT.

ASSY. Nº	E.E.A.2.5.			

SCALE:~ 1/4 FULL SIZE.

DRAWN BY:~ H.F.MARKHAM. 1-4-43.
CHECKED BY:~ R.C.TAYLOR 1-4-43.
TRACED BY:~ M.J.LANDER. 23-4-43.
STRESS. W.A.CARLESS APPROVAL. 1-8-43.
DESIGN APPROVAL.
APPROVED R.T.O.

TAYLORCRAFT AEROPLANES (ENGLAND) LTD. LEICESTER.

TITLE:~ CABIN TOP FRAME ASSEMBLY.

PART Nº EA.10063.

DRWG Nº E.E.A.22.

TRACING CHECKED BY:~ [illegible] 5.7.43